

Safety Bulletin

31965A01

DIVATOR BCW with Inflation Cylinder

TÄBY August 7, 2012

ANNOUNCEMENT

Important information regarding DIVATOR BCW with Inflation Cylinder

APPLIES TO

Products 99095-xx equipped with an extra cylinder for emergency inflation.

DESCRIPTION

If the Exhaust Valve is mounted incorrect, the exhaust flow might be restricted or blocked. If this happens, the bladder in the DIVATOR BCW may burst and lose buoyancy.

One example of incorrect mounting is to place an Inflator gasket or Inflator cylinder gasket in the exhaust valve connection. This will prevent the Exhaust Valve from opening.

Correct: No gasket in Exhaust Valve



Wrong! Gasket placed in Exhaust Valve connection



CORRECTIVE ACTIONS

All new DIVATOR BCW with extra Inflation Cylinder will be equipped with an additional Exhaust Valve. The additional exhaust valve will replace the upper dump valve.

This upgrade is free of charge and all inflator units shall be sent to Interspiro AB for upgrade.

Use the Interspiro Return Authorisation found at www.interspiro.com/RA

Upper dump valve



New exhaust valve

